
Instructions for Wiring Harness - Main
S.66820
Fits: Ford NAA, Jubilee w/ Generator

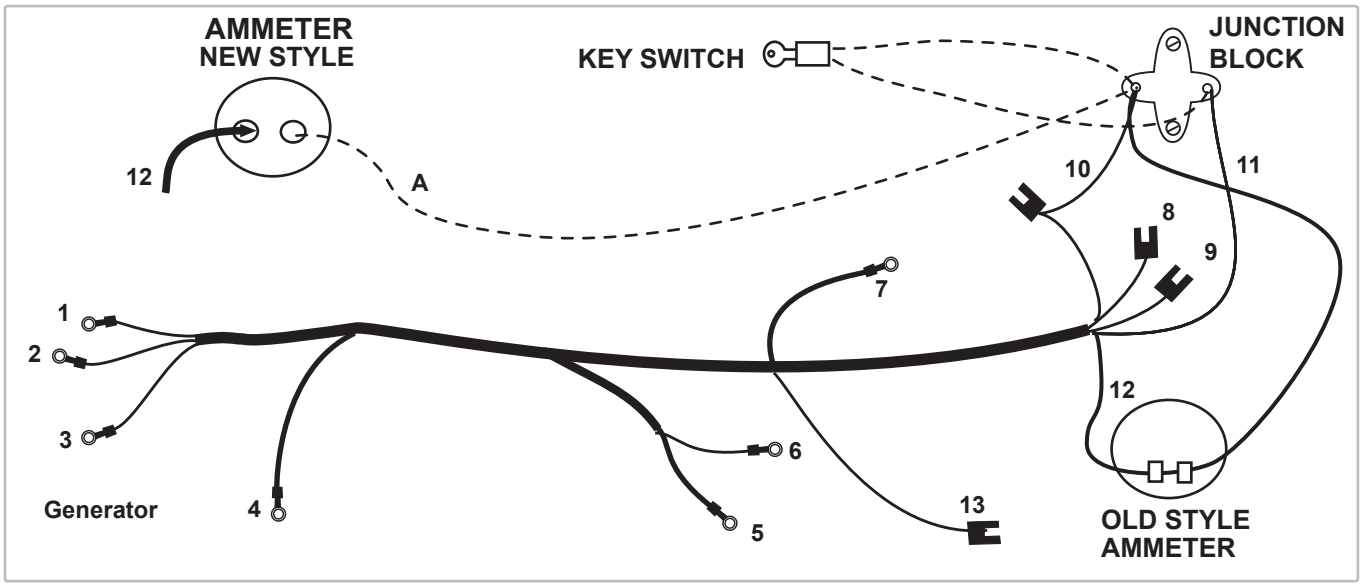

COMPLETE HARNESS

GENERATOR

1- Red	Armature - Rear Terminal
2- White	Field (Insulated Terminal)
3- Black	Ground

COIL & SOLENOID

4- Red	Ignition Coil - Routed behind Cylinder Head
5- Yellow	Starter Solenoid w/ Battery Cable
6- Red	Starter Solenoid (Small Terminal)

REGULATOR

7- Black	Ground - Mounting Block
8- Red	Armature
9- White	Field
10- Yellow	Battery

JUNCTION BLOCK

10- Yellow - Short	Junction Block
11- Red	Junction Block w/ 1 Switch Wire
12- Yellow (Long)	Thru Ammeter to Junction Block or LH Terminal Ammeter.
12- Jump Wire	Junction Block from RH Terminal of Ammeter
13- Red w/ Boot	Starter Push Button

'A' RH Ammeter Terminal to Botton of Resistor must be fabricated. Not part of harness.

190 Lena Dr. • Aurora, OH 44202 • PHONE 330-562-8150 • FAX 330-562-5784 • us.sparex.com
© 6/2019